


Verification Report

FNC1010088985801215717210814211112512-0141

GS1 DataMatrix

Print Quality: **3.0/08/660 (B) - Pass (≥1.5)**

Application Validation: **Fail**

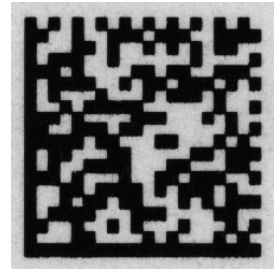

Software Version:	7.1.0	Serial Number:	15394
Scan Time:	4/1/2025 12:22:24 PM (-0400)	Factory Configuration:	2/27/2025
Decode Time:	4/1/2025 12:22:24 PM (-0400)	User Calibration:	3/14/2025
Computer Name:	JOHN-WKST	User Name:	John Nachtrieb

Matrix Size	20x20
Minimum Reflectance	2%
Maximum Reflectance	87%
X Dimension	678 µm
Y Dimension	687 µm
X Print Gain	43 µm, 6%
Y Print Gain	149 µm, 22%

GS1 Data Content (Fail):	(01)00889858012157(17)210814(21)1112512-0141
GS1 Healthcare (bedside) (Fail):	(01)00889858012157(17)210814(21)1112512-0141

Barcode Test Verification Report:

ISO Parameter	Grade	Percentage
Overall	3 (B)	
Decode	4 (A)	
Symbol Contrast	4 (A)	85%
Axial Non-Uniformity	4 (A)	1%
Grid Non-Uniformity	4 (A)	9%
Modulation	3 (B)	
Reflectance Margin	3 (B)	
Unused Error Correction	4 (A)	100%
Contrast Uniformity		42%
Fixed Pattern Damage	4 (A)	

Print Quality Standard: ISO/IEC 15415
Symbology Specification: ISO/IEC 16022
Verifier Conformance Standard: ISO/IEC 15426-2

Axicon Camera Verifier 7.1.0
Axicon Auto ID Limited www.axicon.com